



DIGI INTERNATIONAL

9350 Excelsior Blvd, Suite 700

Hopkins, MN 55343, USA

+1 (952) 912-3444 | +1 (877) 912-3444

www.digi.com

Digi XBee Industrial Gateway Release Notes

Digi XBee Industrial Gateway Cellular

Version 3.2.32.20 (May 2026)

Digi XBee Industrial Gateway Ethernet

Version 3.2.32.20 (May 2026)

INTRODUCTION

These are the release notes for Digi XBee Industrial Gateway Cellular and Digi Industrial Gateway Ethernet products.

The XBee Gateway is a small ZigBee to IP gateway that provides low-cost IP networking of RF devices and sensor networks. Featuring an easy development environment, XBee Gateway enables custom applications to run locally while interfacing across existing Ethernet/Wi-Fi networks for WAN connectivity to cloud-based software applications.

The XBee Gateway products feature an end-to-end development environment based on Digi's DIA framework, allowing for rapid M2M-specific application development on the industry standard Python scripting engine. Digi ESP provides an IDE featuring device detection, debugging, compiling and downloading of Digi DIA/Python code to Digi gateways.

Digi Remote Manager, a Digi-hosted remote management service, offers a platform for secure, scalable access to an unlimited number of remote assets. In addition, the Remote Manager web services provide seamless integration from Digi gateways into customer back office applications.

SUPPORTED PRODUCTS

- XBee Industrial Gateway - HSPA+ GSM
- XBee Industrial Gateway - LTE Cat 1
- XBee Industrial Gateway - Ethernet

KNOWN ISSUES

- OTA update of sleepy XBee 3 nodes with long sleep periods (greater than several seconds) may not succeed. Workaround: configure the node with a shorter sleep period or disable sleep while

updating.

UPDATE CONSIDERATIONS

- As of firmware version 3.2.30.4, the factory default settings for ADDP and HTTP/HTTPS web UI access have changed. Updating to 3.2.30.4 does not change the existing configuration of the gateway.
 - ADDP is now Read-Only by default.
 - Accessing the web interface by HTTP is disabled by default; access to the web interface by HTTP (port 80) redirects to HTTPS (port 443).
 - Accessing the configuration of the product via the web interface now requires user authentication. Use the python username and password to authenticate.
- XBee Gateway devices shipped with firmware version 3.2.30 or higher are manufactured with a unique per-device password. Devices shipped with older firmware have no unique per-device password.
- Be aware that firmware downgrade is not supported on XBee Gateway devices.

UPDATE BEST PRACTICES

Digi recommends the following best practices:

1. Test the new release in a controlled environment with your application before you update production devices.
2. Unless otherwise noted, apply updates in the following order:
 1. Device firmware
 2. Modem firmware
 3. XBee firmware
 4. Configuration
 5. Application

Digi recommends Digi Remote Manager for automated device updates. For more information, go to <https://www.digi.com/products/iot-platform/digi-remote-manager>.

If you prefer manually updating one device at a time, follow the instructions in the XBee Gateway user guide: [Update firmware from the XBee Gateway web interface](#)

TECHNICAL SUPPORT

Get the help you need via our Technical Support team and online resources. Digi offers multiple support levels and professional services to meet your needs. All Digi customers have access to product documentation, firmware, drivers, knowledge base and peer-to-peer support forums.

Visit us at <https://www.digi.com/support> to find out more.

CHANGE LOG

VERSION 3.2.32.20 (May 2026)

This is a recommended release

ENHANCEMENTS

- A new RCI setting, `<mobile><register_time>...</register_time></mobile>`, has been added, with default of 30 seconds. After failing to register to a cellular network three times - waiting this long each time - the cellular modem is reset. Some global SIM cards require a higher value; consult with your cellular provider to determine an appropriate value. [XBGW-3390]

SECURITY FIXES

- Addressed vulnerabilities related to the web interface and data handling. [XBGW-3393]

BUG FIXES

- Doing an XBee discovery with the clear option will automatically fetch the version information if the `<xbee><fw_update>` option is on. [XBGW-3266, XBGW-3354]

VERSION 3.2.32.11 (November 2022)

This is a recommended release

ENHANCEMENTS

- Added a `<mobile><enabled>` element to RCI configuration for all cellular XBee Gateway variants. When set to “off” the connection status will be disabled and the system will not repeatedly try to enable it.
- Updated Python from baseline of 2.7.1 to 2.7.18. Refer to the [What's New in Python 2.7 documentation](#) for information on language and standard library changes. [DBL-1078]
 - Changes to the `ssl` module may require modifications to your existing Python application code. Refer to the “Python SSL changes” section below, and the [Python ssl documentation](#), for more information.
 - As with every new release it is strongly recommended that thorough validation testing be performed in a test environment with the new version prior to deployment into a production environment.
- Doing an XBee discovery with the clear option will wipe out the cached version information for the nodes. This allows the version information to update when changed due to an out of band update, i.e over a local serial update. [XBGW-3266]

SECURITY FIXES

- Updated to OpenSSL 1.1.1q
- Update chrony to receive security issue fixes
 - CVE-2012-4502
 - CVE-2012-4503
 - CVE-2014-0021
 - CVE-2015-1853
 - CVE-2015-1821
 - CVE-2015-1822
 - CVE-2016-1567
 - CVE-2020-14367
- Update Dropbear SSH to receive security issue fixes
 - CVE-2020-36254

- CVE-2019-12953
- CVE-2018-15599
- Update Busybox to version 1.34.1 to receive security issue fixes
- Update wpa_supplicant to version 2.10 to receive security issue fixes

BUG FIXES

- The stored source route record for a given remote node is now cleared after a TX error. [XBGW-3345]

Python SSL changes

This release updates the Python installation inside of XBee Gateway from a baseline of Python 2.7.1 to Python 2.7.18, the final 2.7 release. The most important change resulting from this update to be aware of is that server certificate verification is now [enabled by default](#) in HTTP client code in the Python standard library.

In earlier firmware releases, Python did not perform this verification by default. As a result, updating to firmware 3.2.32.x or newer will require you to review and test your existing Python application, and if your code uses `httplib` (directly or indirectly) and creates HTTPS connections, you will need to modify it to work correctly.

There are two options:

1. Upload the correct CA certificate into the gateway, and update the code to pass an SSL context configured for that CA certificate into the HTTPS connection. (Due to space limitations, XBee Gateway does not ship with a set of CA certificates, so managing this certificate is left to the user.)
2. *Not recommended for security reasons:* Add the line `ssl._https_verify_certificates(False)` early in your Python code, to disable this HTTPS server verification by default. This will revert Python to using the more permissive behavior.

VERSION 3.2.31.20 (July 2022)

This is a recommended release.

ENHANCEMENTS

- XBee Over-the-Air (OTA) can now update XBee RR and S2C NG Zigbee firmware.

BUG FIXES

- Reliability improvements to XBee 3 and XBee RR Over-the-Air (OTA) updates. [XBGW-3187]
- Reliability improvements to XBee S2/S2C Over-the-Air (OTA) updates. [XBGW-3225]
- Each XBee unicast transmission is now preceded by a Create Source Route API frame, to improve data reliability. [XBGW-3199]
- On a failed XBee OTA update, attempt to update with other XBee nodes on the network first, before trying Recovery Mode. [XBGW-3236]
- Adjust implicit timeout for Remote AT Commands to improve reliability on large XBee networks. [XBGW-3184]

VERSION 3.2.31.12 (September, 2021)

This is a recommended release.

ENHANCEMENTS

- Improved timeout behavior of XBee 3 Over-the-Air (OTA) updates.
- Updated ppp and busybox packages to receive security issue fixes
 - ppp
 - CVE-2018-11574
 - CVE-2020-8597
 - CVE-2014-3158
 - busybox
 - CVE-2018-1000517
 - CVE-2018-1000500
 - CVE-2016-6301
 - CVE-2016-2148
 - CVE-2018-20679
 - CVE-2019-5747
 - CVE-2013-1813 NOTE: The busybox change includes fixes that modify shell script and command behavior. As with every new release it is strongly recommended that thorough validation testing be performed in a test environment with the new version prior to deployment into a production environment.
- Modify cellular configuration in preparation for the global 3G sunset.

BUG FIXES

- Fix repeated “size error” message in xbee.log. [XBGW-3092]
- XBee OTA updates could get stuck in the “Scheduled” state. [XBGW-3093]
- XBee OTA updates could cause the xbee daemon to restart, losing memory of network state and update progress. [XBGW-3170]

VERSION 3.2.30.9 (September 2020)

This is a recommended release

ENHANCEMENTS

- XBee Over-the-Air (OTA) can now update XBee 3 device firmware and file system images.

VERSION 3.2.30.6 (May 2020)

This is a recommended release.

SECURITY FIXES

- High level security updates (CVSSv3 scoring 7.3 - CVSS:3.1/AV:N/AC:L/PR:L/UI:R/S:U/C:H/I:H/A:N) to address common weakness enumerations (CWE-250) - Execution with unnecessary privilege within the product. These were discovered and reported to Digi by Jake Valletta and Sam Sabetan from FireEye Mandiant. [XBGW-3005]
- Updated to OpenSSL 1.0.2u

VERSION 3.2.30.4 (December 2019)

This is a recommended release.

NEW FEATURES

- Changes for California SB-327. See ENHANCEMENTS below.

- Created new Authentication web page.
 - New web page added allowing the python user password to be changed. [XBGW-2965]
 - Web UI authentication enable/disable option added to web UI. [XBGW-2966]
- RCI `do_command set_password` can be used to set the python user password. See product documentation for more information. [XBGW-2967]

ENHANCEMENTS

- Changes for California SB-327

In order to comply with regulations in the state of California (SB-327), this firmware now supports being manufactured with a unique per-device password. Existing products manufactured prior to this change will continue to default to the prior fixed password 'dbps' for the python user, but will be impacted by changes to defaults that have been made.

When applicable, this password is the initial factory default value for the 'python' user and can be found printed on a label attached to the product. As always, Digi recommends that users take the opportunity to change the password to a value known only to themselves when performing the initial configuration of the product.

- The default factory setting for ADDP is now Read-Only. This means the XBee Gateway can be discovered using the Digi Device Discovery tool, but configuration may only be performed via the web interface, SSH, or through Digi Remote Manager. Note that ADDP on XBee Gateway does not support a password - keep this in mind if you choose to configure ADDP to be Read-Write, or if upgrading an existing product where ADDP is Read-Write by default.
- Accessing the configuration of the product via the web interface now requires user authentication. You may use the python username and password to authenticate.
- Accessing the web interface by HTTP is now disabled in factory defaults; access to the web interface by HTTP (port 80) redirects to HTTPS (port 443).
- This firmware has been tested and confirmed to operate with the new 20.00.016 and 20.00.526 firmware for the Telit LE910 modem module.

SECURITY FIXES

- Fixes to address Selective ACK security issues
 - CVE-2019-11477 SACK Panic
 - CVE-2019-11478 SACK Slowness
 - CVE-2019-11479 Excess Resource Consumption Due to Low MSS Values

BUG FIXES

None.

VERSION 3.2.29.7 (February 11, 2019)

This is a recommended release.

NEW FEATURES

None.

ENHANCEMENTS

None.

SECURITY FIXES

None.

BUG FIXES

- When resetting the XBee Gateway to factory defaults, the factory default password will now be used (user/pass: python/dbps). [XBGW-2781]
- Fixed issue where DNS lookups were being cached even if the zone/file CNAME mapping had been updated. [XBGW-2904]

VERSION 3.2.27.13 (February 6, 2019)

This is a recommended release.

NEW FEATURES

- This release extends capability in cell module management to assist upgrading modules impacted by an Intel chipset defect. This defect affects certain modules on the Verizon network after March 30, 2019. More information may be found at <https://www.digi.com/verizon-upgrade>.

Currently the issue is known to include certain revisions of the Telit LE910 used on some XBee Industrial Gateway variants supported by this firmware.

ENHANCEMENTS

None.

SECURITY FIXES

None.

BUG FIXES

None.

Release Notes Part Number: 93001304